Memory Module Specification

KHX4000K2/512

512MB (256MB 32M x 64-Bit x 2 pcs.) PC4000 CL3 184-Pin DIMM Kit

DESCRIPTION:

Kingston's KHX4000K2/512 is a kit of two 32M x 64-bit (256MB) DDR500 CL3 SDRAM (Synchronous DRAM) memory modules. Total kit capacity is 512MB. The components on each module include eight 32M x 8-bit (8M x 8-bit x 4 Bank) DDR500 SDRAM in TSOP packages. Each 184-pin DIMM uses gold contact fingers and requires +2.6V. The electrical and mechanical specifications are as follows:

FEATURES:

- Power supply: Vdd: $2.6V \pm 0.1V$, Vddq: $2.6V \pm 0.1V$
- Double-data-rate architecture; two data transfers per clock cycle
- ☑ Bidirectional data strobe(DQS)
- ☑ Differential clock inputs(CK and CK)
- DLL aligns DQ and DQS transition with CK transition
- Programmable Read latency 3 (clock)
- Programmable Burst length (2, 4, 8)
- Programmable Burst type (sequential & interleave)
- \Box Timing Reference: 3-4-4-8-1 at +2.6V
- Edge aligned data output, center aligned data input
- Auto & Self refresh, 7.8us refresh interval (8K/64ms refresh)
- Serial presence detect with EEPROM
- High Performance Heat Spreader
- PCB: Height 1.250" (31.75mm), single sided component


PERFORMANCE:

Clock Cycle Time (tCK)	5ns (min.) / 10ns (max.)
------------------------	--------------------------


Row Cycle Time (tRC) 55ns (min.)
Refresh Row Cycle Time (tRFC) 70ns (min.)


Row Active Time (tRAS) 40ns (min.) / 70,000ns (max.)
Power (IDD0) 2.184 W (operating per module)


✓ UL Rating
 ✓ Operating Temperature
 ✓ Storage Temperature
 94 V - 0
 © C to 70° C
 ✓ 55° C to +150° C

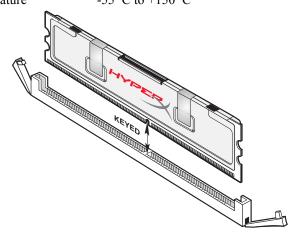


MODULE DIMENSIONS:



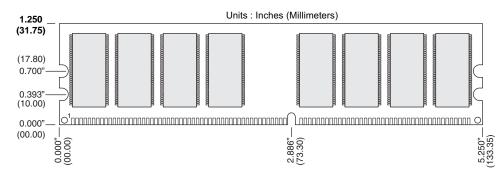

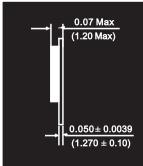

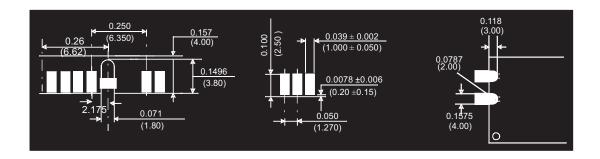

For more information, go to www.kingston.com

All Kingston products are tested to meet our published specifications. Some motherboards or system configurations may not operate at the published HyperX memory speeds and timing settings. Kingston does not recommend that any user attempt to run their computers faster than the published speed. Overclocking or modifying your system timing may result in damage to computer components.